

"The Right Bond"

## Technical Datasheet HOLDIT AUSTRALIA G58

Revised Date: MARCH 2020

### Description

HOLDIT AUSTRALIA G58 Flexible Gasket Maker is a single component, medium strength, Thixotropic, anaerobic sealant which cures when confined between close fitting metal surfaces. G58 Flexible Maker provides an instant low pressure seal.

### **Applications**

G58 seals joints between rigid metal faces and flanges such as valve covers and gearbox castings. This product can be used with or without pre-cut, pre-formed gaskets.

### Instructions for Use


- 1. For best results clean all surfaces with a cleaning solvent and allow to dry.
- If the metal is inactive or the cure speed is too slow apply HOLDIT AUSTRALIA AA471 Activator or HOLDIT AUSTRALIA AA649 Accelerator. Please see table below for information on Active and Inactive metals.
- 3. Before application shake the product thoroughly.
- 4. Apply the adhesive to the fixing position of the fastener or onto the internal threads of a blind hole.
- 5. Assemble components, and tighten to require torque level.
- 6. Allow to fully cure before applying load.

### Properties of Uncured Material.

Resin	Modified	
	Urethane Acrylate	
Colour	Red	
Shelf Life	24 months	
Viscosity	800,000-	
	3,750,000cps	

# Performance of Cured Material Fixture Speed w/Activator <10 mins Fixture Speed w/out Activator 20 mins Full Cure 24 hrs @ 20°C Gap Fill .3mm Temperature Range -53°C to 148°C Shear Strength 6Nm / 10Nm Product Conformity GM-1182863

### **Cure Speed**

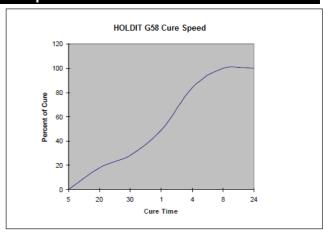

### Environmental and Fluid Resistance (Shear Strength Values)

Heat Age	100%
Engine oil @ 150°C	100%
Brake Fluid @ 150°C	80%
ATF @ 150°C	85%
50/50 water / ethylene glycol	85%
@ 120°C	
Water @ 100°C	80%
Gasoline @ 25°C	85%
Diesel Fuel @ 25°C	100%
Ethyl Alcohol @ 25°C	90%

### **ACTIVE & INACTIVE METAL TABLE**

Super Active	Active	Inactive	Passive
Very Fast Cure	Fast Cure	Slow Cure	Primer Necessary
Brass, Copper, Magnesium	Iron, Steel, Nickel, Aluminium	Stainless Steel, Titanium, Zinc, Anodized Aluminium,	Ceramics, Glass, Plastics, Painted Finishes
	Aluminum	Galvanised Steel	Fainteu Finishes

The information contained herein is produced in good faith and is believed to be reliable but is for guidance only. Holdit Australia Pty Ltd and its agents cannot assume liability or responsibility for results obtained in the use of its products by persons whose methods are outside or beyond our control. It is the users responsibility to determine the suitability of any of the products and methods of use or preparation prior to use mentioned in out literature and furthermore the users responsibility to observe and adopt such precautions as may be advisable for the protection of personnel and property in the handling and use of any of our products.

PAGE 1 OF 2



### Technical Datasheet HOLDIT AUSTRALIA G58

Revised Date: MARCH 2020

### **Compatible Primers**

Primer such as AA649 Accelerator and AA471 Activator can be used to speed the fixture time of the adhesive. Fixtures times can improve by as much as 50%. The use of primers can result in lower strength and performance and should be tested after full cure.

### Storage

HOLDIT AUSTRALIA G58 should be stored in a dry cool area, out of direct sunlight in temperatures between - 10°C and 30°C. Optimal Storage temperature is 22±4°C.

This product has a 24 month shelf life from manufacture when stored at 22±4°C.

### Presentation

HOLDIT AUSTRALIA G58 is available in 50ml and 250ml Tubes.

#### Note

Where gap size is large or where the surface is uneven, apply a HOLDIT AUSTRALIA Primer to assist curing the product. G58 Flexible Gasket can be roller coated, screen printed or pad applied.

### Health & Safety in Use

IRRITANT: Contains Methacrylate Esters and some products contain small amounts of Acrylic Acid. Irritates eyes, the respiratory organs and the skin. In case of contact with the skin wash immediately with plenty of water.

### Conversions

(°C x 1.8)+32 = °F N/mm x 5.71 = lb/in MPa x 145 = psi N/mm2 x 145 = psi N x 0.225 = lb N·m x 8.851 = lb·in N·mm x 0.738 = lb·ft mPa·s = cP

#### **ACTIVE & INACTIVE METAL TABLE**

Super Active	Active	Inactive	Passive
Very Fast Cure	Fast Cure	Slow Cure	Primer Necessary
Brass, Copper, Magnesium	Iron, Steel, Nickel,	Stainless Steel, Titanium,	Ceramics, Glass, Plastics,
	Aluminium	Zinc, Anodized Aluminium,	Painted Finishes
		Galvanised Steel	

The information contained herein is produced in good faith and is believed to be reliable but is for guidance only. Holdit Australia Pty Ltd and its agents cannot assume liability or responsibility for results obtained in the use of its products by persons whose methods are outside or beyond our control. It is the users responsibility to determine the suitability of any of the products and methods of use or preparation prior to use mentioned in out literature and furthermore the users responsibility to observe and adopt such precautions as may be advisable for the protection of personnel and property in the handling and use of any of our products.

PAGE 2 OF 2